



A publication of Tucker Sno-Cat® Corporation
NO SNOW TOO DEEP

Made in the USA since 1942
NO ROAD TOO STEEP

July 2010 Volume 2 Issue 7

Happy 4th of July!



Heim Joint Maintenance

If your cat has been manufactured using heavy-duty tie rod ends known as “Heim Joints” (See below for an expanded view) then be sure and keep up on the maintenance.

Heim Joints need to be greased at least every 25 hours. In addition to grease Tucker Sno-Cat® Corporation recommends to tighten the Heim Joints after the first 40 hours of operation. Then check for looseness at least every 100 hours or as required. If the Heim Joint needs to be adjusted, loosen the set screw (see expanded view). Then tighten as tight as possible by hand with the provided wrench. Be sure and use blue (medium strength) LOC-TITE on the set screw. Always be sure to grease the Heim Joint before adjustment. The Heim Joint requires an extreme pressure grease (SCHAEFFER 229 #2). The torque setting for the Heim Joint securement bolt is 450 ft. lbs.


Maintenance Seminar

Tucker Sno-Cat® Corporation will be having a maintenance training seminar September 7th – 8th. The seminar will be at our factory location – 2872 S. Pacific Hwy. Medford, OR 97501. This two day seminar will cover:

1. Basic Components of the machine
2. How the machines are assembled
3. Factory tour
4. Service and maintenance
5. Questions and answers.

The cost will be \$295.00 per person. This includes coffee and donuts in the morning and lunch both days.

Please respond either by e-mail (john@sno-cat.com) or contact John Meilicke at 541-779-3731.

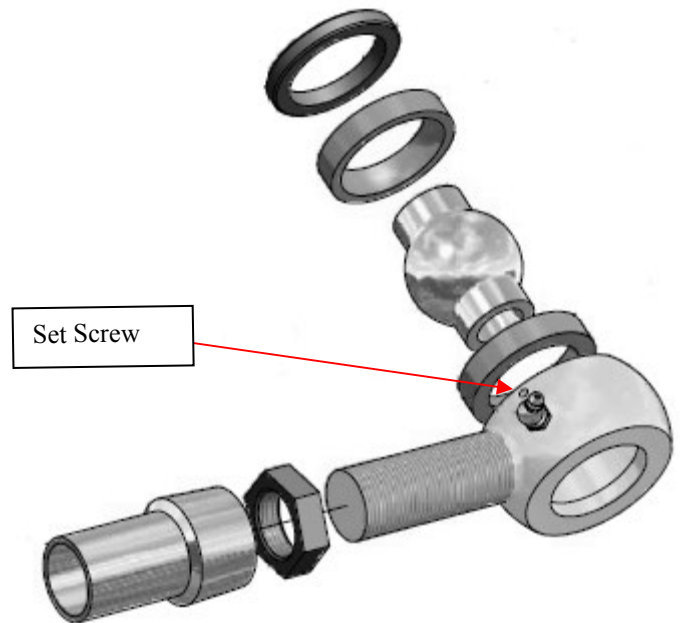

Tucker Sno-Cat® Corporation
2872 S. Pacific Hwy
Medford, OR 97501

www.sno-cat.com
(541) 779-3731
Toll Free (866) 766-2281